METRIC DIGITAL INDICATORS

DATA OUTPUT

INSPECTION CERTIFICATE



2116-10



2116-251



2116-251P



2116-501



2116-10
2116-101

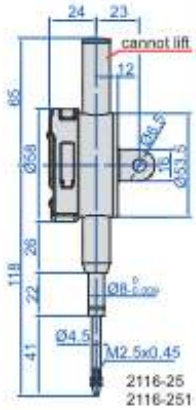

2116-25
2116-251

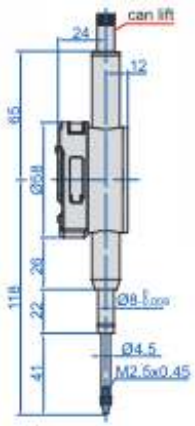

2116-25P
2116-251P

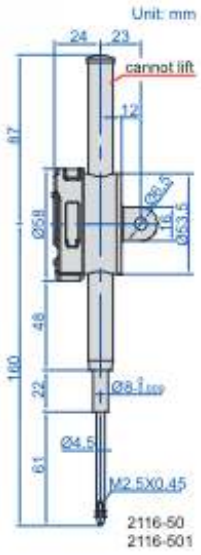

2116-50
2116-501

- Button function: on/off, zero, data preset, change measuring direction, absolute/incremental measurement
- Switchable high/low frequency measurement mode, high frequency mode is suitable for high speed moving of spindle and has large power consumption, low power consumption in low frequency mode
- Keep preset data in memory after restart
- CR2032 battery, automatic power off (time is adjustable)
- Data output
- Optional accessory: wireless transmitter code **7315-50M** (receiver is needed) page 8, data output cable code **7302-40M** page 16, **7305-40M** page 19, backs (page 315~316), contact points (page 310~314)

Resolution 0.001mm

Code	Range	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2116-101F*	12.7mm	5μm	2μm	1.5N	can lift	flat back
2116-251F*	25.4mm	5μm	3μm	2.2N	cannot lift	flat back
2116-501F*	50.8mm	6μm	3μm	2.5N	cannot lift	flat back
2116-101*	12.7mm	5μm	2μm	1.5N	can lift	lug back
2116-251*	25.4mm	5μm	3μm	2.2N	cannot lift	lug back
2116-501*	50.8mm	6μm	3μm	2.5N	cannot lift	lug back
2116-251P*	25.4mm	5μm	3μm	2.2N	can lift	flat back
2116-501P*	50.8mm	6μm	3μm	2.5N	can lift	flat back

Resolution 0.01mm

Code	Range	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2116-10F*	12.7mm	20μm	10μm	1.5N	can lift	flat back
2116-25F*	25.4mm	20μm	10μm	2.2N	cannot lift	flat back
2116-50F*	50.8mm	30μm	10μm	2.5N	cannot lift	flat back
2116-10*	12.7mm	20μm	10μm	1.5N	can lift	lug back
2116-25*	25.4mm	20μm	10μm	2.2N	cannot lift	lug back
2116-50*	50.8mm	30μm	10μm	2.5N	cannot lift	lug back
2116-25P*	25.4mm	20μm	10μm	2.2N	can lift	flat back
2116-50P*	50.8mm	30μm	10μm	2.5N	can lift	flat back

*Supplied with manufacturer inspection certificate



spindle lift knob is included

