
DATA OUTPUT INSPECTION CERTIFICATE

DIGITAL INDICATORS WITH LIFTING LEVER

- Reading in digital and analog
- Display can be rotated by 320°
- Button function: tolerance Go and No-Go display, data preset, measuring direction change, max./min./TIR measurement, inch/metric conversion, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off (time is adjustable)
- Data output
- Optional accessory:
  wireless transmitter code **7315-50M** (receiver is needed) page 8, data output cable code **7302-40M** page 16, **7305-40M** page 19, backs (page 315~316), contact points (page 310~314)



2109-10

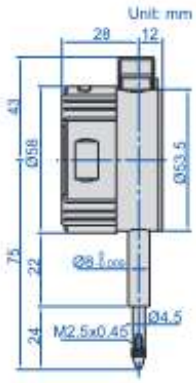





Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Remark
2109-10*	10mm/0.4"	0.01mm/0.0005"	20μm	10μm	1.5N	flat back
2109-101*	10mm/0.4"	0.001mm/0.00005"	5μm	2μm	1.5N	flat back

*Supplied with manufacturer inspection certificate


DATA OUTPUT INSPECTION CERTIFICATE

COMPACT DIGITAL INDICATORS

- Button function:
  in/mm: short press for inch/metric conversion
  long press to change measuring direction
  ABS: short press for absolute/incremental measurement
  long press to preset data
  0/ON: short press to turn on when power is off
  short press to set zero when power is on
  long press to turn off
- Keep preset data in memory after restart
- CR1632 battery, automatic power off
- Data output
- Optional accessory:
  wireless transmitter code **7315-50M** (receiver is needed) page 8, data output cable code **7302-40M** page 16, **7305-40M** page 19, backs (page 315~316), contact points (page 310~314)



2114-51F

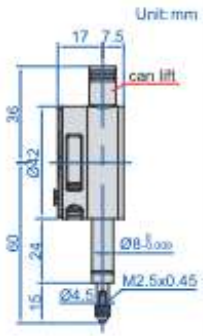

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2114-5F*	5mm/0.2"	0.01mm/0.0005"	20μm	10μm	1.5N	can lift	flat back
2114-51F*	5mm/0.2"	0.001mm/0.00005"	5μm	2μm	1.5N	can lift	flat back

*Supplied with manufacturer inspection certificate