WATERPROOF DIGITAL INDICATORS

WATERPROOF | DATA OUTPUT | INSPECTION CERTIFICATE



2115-10

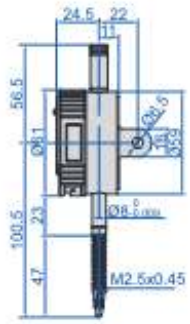

2115-10
2115-101



2115-25

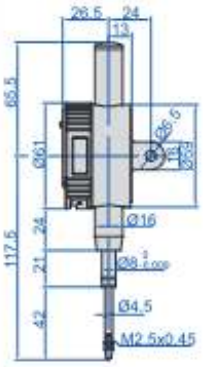

2115-25
2115-251



2115-50

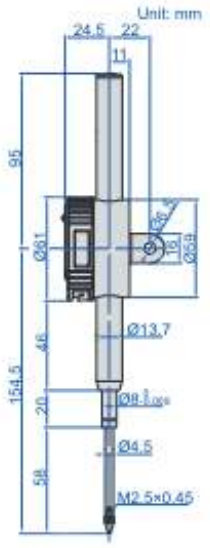

2115-50
2115-501

- Dust/waterproof
- Button function: on/off, zero, mm/inch, data preset, tolerance, change measuring direction, max./min./TIR measurement, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off
- Data output
- Optional accessory:
  wireless transmitter code **7315-50M** (receiver is needed) page 8, data output cable code **7302-40M** page 16, **7305-40M** page 19, backs (page 315~316), contact points (page 310~314)

spindle lift knob is included (except **2115-101/101F, 2115-10/10F**)



max./min./TIR

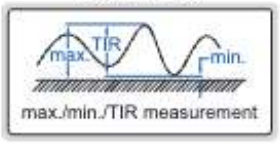

max./min./TIR measurement

alarm when over tolerance



10

Resolution 0.001mm/0.00005"

Code	Range	Dust/waterproof	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2115-101*	12.7mm/0.5"	IP65	5μm	2μm	1.5N	cannot lift	lug back
2115-251*	25.4mm/1"	IP54	5μm	3μm	2.2N	cannot lift	lug back
2115-501*	50.8mm/2"	IP54	6μm	3μm	2.5N	cannot lift	lug back
2115-101F*	12.7mm/0.5"	IP65	5μm	2μm	1.5N	cannot lift	flat back
2115-251F*	25.4mm/1"	IP54	5μm	3μm	2.2N	cannot lift	flat back
2115-501F*	50.8mm/2"	IP54	6μm	3μm	2.5N	cannot lift	flat back

Resolution 0.01mm/0.0005"

Code	Range	Dust/waterproof	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2115-10*	12.7mm/0.5"	IP65	20μm	10μm	1.5N	cannot lift	lug back
2115-25*	25.4mm/1"	IP54	20μm	10μm	2.2N	cannot lift	lug back
2115-50*	50.8mm/2"	IP54	30μm	10μm	2.5N	cannot lift	lug back
2115-10F*	12.7mm/0.5"	IP65	20μm	10μm	1.5N	cannot lift	flat back
2115-25F*	25.4mm/1"	IP54	20μm	10μm	2.2N	cannot lift	flat back
2115-50F*	50.8mm/2"	IP54	30μm	10μm	2.5N	cannot lift	flat back

*Supplied with manufacturer inspection certificate