PRECISION DIAL INDICATORS


INSIZE PLUS

INSPECTION CERTIFICATE | SHOCK PROOF | JEWELED BEARING

- Shockproof
- Jeweled bearing
- With limit pointers
- Optional accessory: backs (page 315~316), contact points (page 310~314)



2830-1

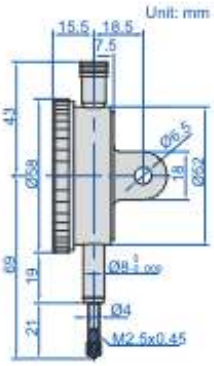

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Maximum measuring force	Cap	Remark
2830-1*	1mm	0.001mm	5μm	2μm	0.2mm	0-100-0	2N	can lift	lug back
2830-1F*	1mm	0.001mm	5μm	2μm	0.2mm	0-100-0	2N	can lift	flat back

*Supplied with manufacturer inspection certificate

HIGH PRECISION DIAL INDICATORS

INSIZE PLUS

INSPECTION CERTIFICATE | SHOCK PROOF


- Shockproof
- Jeweled bearing
- With limit pointers
- Optional accessory: backs (page 315~316), contact points (page 310~314), lifting lever (code **6289-150**)

lifting lever (**optional**)





2891-1

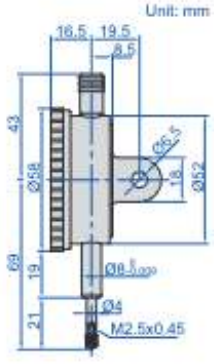

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Maximum measuring force	Cap	Remark
2891-1*	1mm	0.001mm	3μm	1.5μm	0.1mm	0-100	2N	can lift	lug back
2891-1F*	1mm	0.001mm	3μm	1.5μm	0.1mm	0-100	2N	can lift	flat back

*Supplied with manufacturer inspection certificate

10

HIGH PRECISION COMPACT DIAL INDICATORS

INSIZE PLUS

INSPECTION CERTIFICATE | SHOCK PROOF


- Shockproof
- Jeweled bearing
- With limit pointers
- Optional accessory: backs (page 315~316), contact points (page 310~314), lifting lever (code **6289-150**)

lifting lever (**optional**)





2890-1

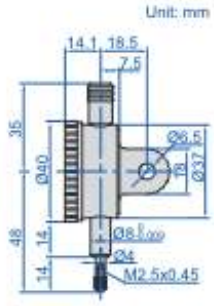

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Maximum measuring force	Cap	Remark
2890-1*	1mm	0.001mm	3μm	1.5μm	0.1mm	0-100	2N	can lift	lug back
2890-1F*	1mm	0.001mm	3μm	1.5μm	0.1mm	0-100	2N	can lift	flat back

*Supplied with manufacturer inspection certificate